. 1	INTELLOFAX	29		RAL INTELLIC					
CO	OUNTRY:	USSR -			*.	•	DATE DI	STR. 25 J	W 52
SU	JBJECT :	Area Desc	ription of	Zavod No	2		NO. OF	PAGES 9	er e
PL AC	ACE CQUIRED:						NO. OF		, 25X1
	ATE QUIRED						SUPPLE REPORT	MENT TO	
DA	ATE OF								25X1
Ge	eneral				78 (1)				
	Zavod: north 150-20 8 km. river the pl and th land.	of Kuibyslom above (Its breatinto two attentions of the control of	ted on the enew. The enew. The fiver, adth is incorrectly the hilly; and levels to the Vols	e east bank plant site which wid creased by west bank towards t entirely, ga freezes	is situate lens at the an island of the ri the south, permitting over to a	ed on a at point which siver, di the hil g a view thickne	to appreparates rectly of many mass of light	about coximately s the opposite e down iles in- in and	
	Zavod north 150-20 8 km. river the pland th land. is use heavie rises is loc rises	of Kuibysholm above (Its breatinto two attent, is queriver bar In winter that trafficated at the control of the	tted on the new. The I the river, dth is income. The including the Volgoria the Volgoria the mean ne end of a vater level	plant site which widereased by west bank towards tentirely, ga freezes ghway. In trucks of level in the ravine in this fa	is situate lens at the an island of the riche south, permitting over to a carrying he che spring, mediately offitates	ed on a at point which siver, di the hil g a view thickned the ice eavy crand the at the	plateau to appr deparate rectly of ls slope many m sss of l; suppor nes. The boath foot of	about coximately s the opposite e down iles in- mand t the he river ouse, which the plan	25 ch t,
_	Zavod north 150-20 8 km. river the pland th land. is use heavie rises is loc rises	of Kuibysholm above (Its breatinto two attent, is queriver bar In winter that trafficated at the control of the	tted on the new. The I the river, dth is income. The including the Volgoria the Volgoria the mean ne end of a vater level	plant site which widereased by west bank towards tentirely, ga freezes ghway. In trucks of level in the ravine in	is situate lens at the an island of the riche south, permitting over to a carrying he che spring, mediately offitates	ed on a at point which siver, di the hil g a view thickned the ice eavy crand the at the	plateau to appr deparate rectly of ls slope many m sss of l; suppor nes. The boath foot of	about coximately s the opposite e down iles in- mand t the he river ouse, which the plan	25 eh

(20)

Site Layout

sketch Enclosure (A) of Zavod #2, on which the fol-

lowing are shown:

25X1

## Point 1 Guard House

A one-story wooden building at which a guard was stationed. It contained a weapons and uniform arsenal used to implement plant security.

### Point 2 Machine Shop

A hall-type, one-story, brick structure. (It was 6 m high on the side walls and 12 m high in the center.) The roof was supported by steel trusses whose bases were set in cement blocks at about ten meter intervals along the length of the hall. A monitor, about 40 m wide and 6 m high at the crest, formed the center of the roof. The trusses were connected by metal beams on which wooden boards, covered with tar paper, were laid lengthwise on their narrow side. The monitor had windows at its sides. From the east, two gates, about 4 m high, led into the building. (The northern gate was generally kept open; it was high and wide enough to permit trucks to enter.) Along the sides of the building were high windows, evenly spaced. There were no traveling cranes in the machine shop, but several hand-operated chain hoists served in placing pieces of metal into proper position at the various machine tool stands. Three-four hundred people were employed in this shop. Shop was equipped with the following: two-three vertical lathes; at least three heavy lathes with a disc diameter of 1.20 m; and about four smaller lathes of 1 m disc diameter, which were used particularly in the manufacture of compressor casings.

25X1

### Point 3 Annex

This brick building was annexed to the Machine Shop. It was a two-story building about 12 m high. The following were on the first floor:

- (a) Small test stands for pumps, regulators, turbine starters, and combustion chambers.
- (b) Carpenter Shop
- (c) Heat Treatment Shop
- (d) Forge

Until summer 1950, the Annex was used as an assembly hall; it was then converted to its present use. No German personnel worked in the forge shop. The upper story consisted of office rooms. The office of the Soviet Plant Manager and Chief Engineer, <u>Kusnitzov</u>, was directly above the Heat Treatment Shop. The plant Finance Department was above the Forge Shop.

### Point 4 Sheet Metal and Welding Shop

A one-story brick building, about 8 m high, with a curved, truss roof. There were two entrances to this shop--a large entrance gate at the middle of the west side, and another at

the northeast corner of the building. A depository for scrap iron was located east of the building. Tools and sheet metal were stored and issued to the workers in the northeast corner of the shop. The Sheet Metal and Welding Shop offices were located in the southeast corner of the building.

There were no traveling cranes in this shop, but, as in the Machine Shop, several hand-operated hoists were used. Several heavy lathes and a number of filing benches, plate shearers, edging machines, and bending machines were also among this shops equipment. Approximately 100 people worked there.

### Point 5 OKB Building

A two-story brick building, about 12 m high. The main entrance was at the center of the north side. A guard was posted here who checked the identification cards of those entering the building. There were also two small entrances in the wings of the south side. Until September 1950, test stand personnel could enter the southwest portion of the building to visit the Testing Department (Versuchsabteilung) without showing an identification pass. The OKB Building included approximately the following:

The southwest wing, starting from the west:

- (a) The Blue Print Room (Lichtpaus Zimmer)
- (b) File of drawings and central register
- (c) Archives (Special permission to enter the file and archives rooms had to be indicated on the bearers' identification cards, before entry to these rooms was permitted.)

The southwest wing, starting from the east:

- (a) Large drawing room (no Germans worked here)
- (b) Offices of engineers Treiber and Heber
- (c) Drawing rooms of the Treiber Group 25X1

The northeast wing, starting from the east:

- (a) Office of engineer Dornhoefer
- (b) Central office of engineers Treiber and Heber.
- (c) An office in which quota planning was done. 25X1

The northwest wing contained offices which may have belonged to the <u>Madaranski</u> Group

25X1

The southwest wing of the upper floor:

- (a) Testing Department, in which engineers <u>Ceriaitke</u>, <u>Niepmann</u>, <u>Kerwin</u>, <u>Boehlke</u>, <u>Brauer</u>, <u>Wagner</u> and <u>Pohl</u> worked.
- (b) Office of Prestel, Chief of the Testing Department

(c) Office of the Soviet Testing Department Chief, Quassov.
(Quassov was transferred to Moscow in spring 1951 to
take refresher courses.)

25X1

25X1

25X1

(d) With the exception of the "Red Room", the remainder of the south side was assigned to engineers who worked on the planning and designing of engines and engine parts.

25X1

Brandner's office was near
the center of the upper floor and the office of the
Soviet Deputy Chief, Engineer Kutcherenko, was next to

his.

(e) "Red Room" - each department had such a room in which political assemblies were held, and in which trophies for work performance and quota-fulfilling were stored.

The entire north side of this floor was used for offices of the Madaranski Group.

The "Red Room" of the OKB Department was located on the

### Point 6 Old Test Stands

See Enclosure (B)7

(a) Stand 1 - Compressor stand

south side on this floor.

- (b) Stand 2 Propeller stand
- (c) Stand 3 Water brake stand
- (d) Stand 4 Propeller stand

See Point 9 for a description of the new test stands.

### Point 7 Old Fuel Tanks

This installation consisted of three tanks—two of them were about 2 m in diameter and 3 m long, and the other tank was about 2 m in diameter and 6 m long. The tanks were built into the ground and filled by trucks which came from Krasnaya-Glinka. A circulation pump from the tanks provided the test stands with fuel. There was never a shortage of kerosene.

### Point 8 Transformer Station

There were three transmission systems supplying power from outside the plant. The power was probably supplied from Kuibyshev. One system, consisting of four high-tension lines, supplied power for plant operation. Four steel masts, arranged in a square, were located next to the Transformer Station. The transformers were located outside of the building, between the steel masts. The second system supplied power for lighting the plant. The third system was an emergency line which provided the plant with power should the other two systems break down. (Occasionally, during the first two years, an emergency occurred, but the emergency line, too, would break down, and the plant was completely without current.)

The building was a one-story brick structure, about 5-6 m high, 8 m wide, and 20 m long.

25X1

## Point 9 Building 22 (The New Test Stand Building) See Enclosure (C)7

A brick building, about 12 m high, which had a slightly sloping slate roof. There was no entrance into the building from the south side. Two gates, both about 4 x 4 m, afforded access to the building from east and west. There were also open gates leading into each of the test stands from the north side -- these gates were to have descending rolling doors

A small welding shop was located left from the entrance on the east wing.

25X1

Construction on Building 22 was almost completed

25X1

Stand #1, a propeller stand, was operational in September 1950. Test stand #2 was operational for the first time on 7 Nov 51, when the first test on the 022 M engine was conducted. Stand #3 was to be a water brake stand for the testing of engine 022 K:

Work on stand #4 had

not begun in December 1951

25X1

Square exhaust chimneys, 10 m above the crest of the roof, had been erected above all the test stands except #4. (The roof sections above the test stands were only 10 m high, slanting slightly toward the exhaust chimneys.)

Both wings of the building contained offices. There were eight windows along the south and north facade; the only other windows along the northern face of the building were the four in the control rooms of the test stands. The south facade frontage was about 60 m long; nine high windows admitted light into the assembly hall

25X1

The engine assembly hall could be reached through two side gates. Trucks carrying the engines to the test stands were frequently routed through the side gates, when poor weather prevented the use of an uncompleted road which led from the north side of the building to the test stands. Some old engines of the 004 and 018 type were lying on the ground inside of the assembly hall, but no machinery had been installed within. There were two electrically operated traveling cranes in the hall. OKB engineers told that this hall was to be used for the assembly of the 022 M engine. Building 22 contained the fol-

25X1

To the right of the entrance, going north:

- (a) Three storage rooms
- (b) An electric shop
- (c) A shop for accumulator charging
- (d) A room which was to be a blower shop was located right of the entrance, on the west side

The north side:

- (a) Two shower rooms
- Two dressing rooms

Approved For Release 2009/08/25: CIA-RDP81-01028R000100140005-0

(c) Scrap metal room

On the second floor of the east wing (which could be reached through a small door immediately north of the gate, and a staircase which led to a passage spanning the driveway), the following was located, to the left:

- (a) Office of the German chief of the test stands and engine assembly, Alfred Gimm. His room could only be reached by going through the timekeeper's office.
- (b) Office of the timekeeper, who kept personnel charts on which working time and personal achievements were recorded.
- (c) Office of (fnu) Sergyev, the Soviet Chief of the test stands. His former office was in a small room near the old Test Stand #2. He changed offices in fall 1950.
- (d) A small room with drawing boards, which apparently was not assigned to anyone.

The following rooms were located along the right side of the passageway:

- (a) Office of Test Stand Control Chief, (fnu) Katchalov.
- (b) Office of Fritz Wilhelmi, Chief of Material Procurement for all test stands.
- (c) "Red Room" for Building 22.
- (d) A room which was always kept locked.
- (e) A room with drawing boards, where girls made measuring tapes. (Their tapes were sometimes so inaccurate that one of the compressor tests had to be repeated as a result of their being used in making the measurements.)
- (f) Office of (fnu) <u>Herber</u>, Chief Engineer of the entire Test Stand Department, including test stand installations and planning.

The following were along the right of the passageway, on the second floor:

- (a) Office for oil and fuel procurement. The records of oil and fuel supply were kept here, and oil analyses were also made in this office.
- (b) Electric heater for the shower rooms
- (c) Office of the watchmaker, Richard Steffan
- (d) Store room for low voltage electrical equipment

The test stand rooms were  $8\frac{1}{2}$  m square. The walls were 75 cm thick and built of red brick. The ceiling was made of concrete. The exhaust chimneys (not yet installed in Stand #4) were behind the test stand rooms, and were also  $8\frac{1}{2}$  m square.

Diagonally from top to bottom of the exhaust chimneys were shafts on which airfoils were fastened to deflect the exhaust vapors into the chimneys. The control rooms were built about 4 m above the ground floor and could be reached by a stairway from the engine assembly hall. One control room served two test stands; the window overlooking the test stand was only a short distance in front of the exhaust chimney. There were two small rooms, about 2 m wide, immediately north of one control room. They contained the oil coolers and fuel filters. Stairs led from the control rooms to a gallery on which electric installations such as transformers, switchboards, and meters were mounted. The gallery enclosed a large hall on the ground floor which was not used for any specific purpose. Along the wall of this hall were pipes and lines which connected the test stands with the control rooms.

### Point 10 A Fuel Tank Installation for the New Test Stands

Several tanks (exact number unknown), about 2 m in diameter and 6 m long, were built into the ground.

#### Point 11 Air Compressor House

Bottles were filled with air to a pressure of 120 atmospheres in this building. The pressured air was used for welding and for starting the 012 engine. Two-three compressors were located in the building, which was an old wooden structure. Only Soviet personnel were employed in the Air Compressor House.

### Point 12 Heating Plant

This plant, about 10 m high, was built into the slope at the rim of the plateau on which Zavod #2 is situated. There was a pile of sludge coal on the east side of the building. The coal was shoveled into the Heating Plant by means of chutes.

### Point 13 Engine Assembly Hall

The center hall was a one-story structure about 8 m high, with two-storied north and south wings about 12 m high. The wings could be reached by stairs which led to a connecting gallery. The following were located in the south wing: a soldering shop, a room in which nuts and bolts were stored, and the office of engineer Steuk, who was in charge of engine assembly. A fuel purification installation was in the north wing. (In the center of the east side of the building was an entrance gate which was so low that the truck with the twin 022 M engine could pass through the gate only when the air was released from the truck tires.) The center hall ceiling was flat with cross-beams running the width of the ceiling. There were two hand-operated cranes used in this center section. Each crane had two pulleys and ran on rails, operated by bogie and cog wheels. Boxes in which the engines could be assembled were located in the center hall; seven engines could be assembled at one time. Along the sides were filing benches and lathes; also the assembly of reduction gears and turbine starters. Only Soviet personnel were employed in the upper stories of the wings. About 100 persons per shift were employed in the assembly of engines.

-8-

### Point 14 Materials Analysis Laboratory

A two-story brick building about 12 m high. A little tower in which the fire department posted its lookout was built onto the west side. Tests were conducted in the northeast wing. Precision mechanics shops, lathes for watchmakers, photographic laboratories, etc, were located in the southwest wing.

### Point 15 Guard Towers

25X1

### Point 16 Paved Roads

### Point 17 Cleared Area

Originally this area was assigned for the construction of the altitude test stands, dismantled from Dessau. However, work on this project was discontinued and all associated equipment was recrated and shipped out in the period from May until September 1951. The crating and numbering of the equipment was supervised by <u>Boelke</u> and <u>Groebner</u>, both German engineers in charge of the stands in Dessau.

### Point 18 Wooden Fence

Six meters high. The guards stationed at the towers (Point 15) were instructed to shoot at anyone approaching within three meters of the inside of the fence.

#### Security Measures

3. The chief of the MVD at Zavod #2 was (fnu) Kolichenko. There were many security measures at the plant, all of which were stringently enforced. Upon arrival at the Guard House (Point 1), Zavod #2 employees were to tell the guard the number of their identification card, whereupon the card was given to them; with this they could enter the plant compound. The cards bore various stamps, which indicated the departments to which the bearers were permitted to enter.

the stamp permitting entrance to the OKB design offices bore the number "5" and the stamp for admission into the assembly hall was numbered "12"

25X1

25X1

25X1

- 4. At the entrance of the OKB Building, identification cards had to be relinquished to the guard, who kept it until the bearer left the building. Upon leaving the plant compound, the card had to be returned to the guard at the Guard House gate. These guards were generally women, dressed in a black uniform, black overcoat and cap; they had revolvers at their belts.
- 5. Another point in the plant where identification was checked was at the entrance to Department 14, Test Stands. The entire area of the test stands was surrounded by a wooden fence, about 6 m high. The entrance to this enclosure was also guarded by women. This security measure was deemed necessary because no outsider was to see the propellers which were mounted outside of the Test Stand Building. A guard was also stationed at the entrance of Building 22 (the New Test Stand Building).

6. The entire compound was surrounded by a wooden fence about 4 m high, interspersed about every 150 m by wooden watch towers. Guards, stationed here night and day, were equipped with single-shot rifles. Additional "prowl" guards patrolled the area at night. Areas in which penal laborers were working (many were employed in the erection of buildings, digging foundations, etc) were surrounded by barbed wire fences, at the top of which guard towers were situated. The penal workers were guarded by men wearing black uniforms, with green shoulder emblems. These guards, accompanied by dogs, were armed with automatic pistols.


-end-

- ENCLOSURE (A) Memory Sketch of Zavod #2
- ENCLOSURE (B) External Views of Old Test Stands
- ENCLOSURE (C) New Test Stands (Building 22)

25X1


SECRET/SECURITY INFORMATION


Evel "A"

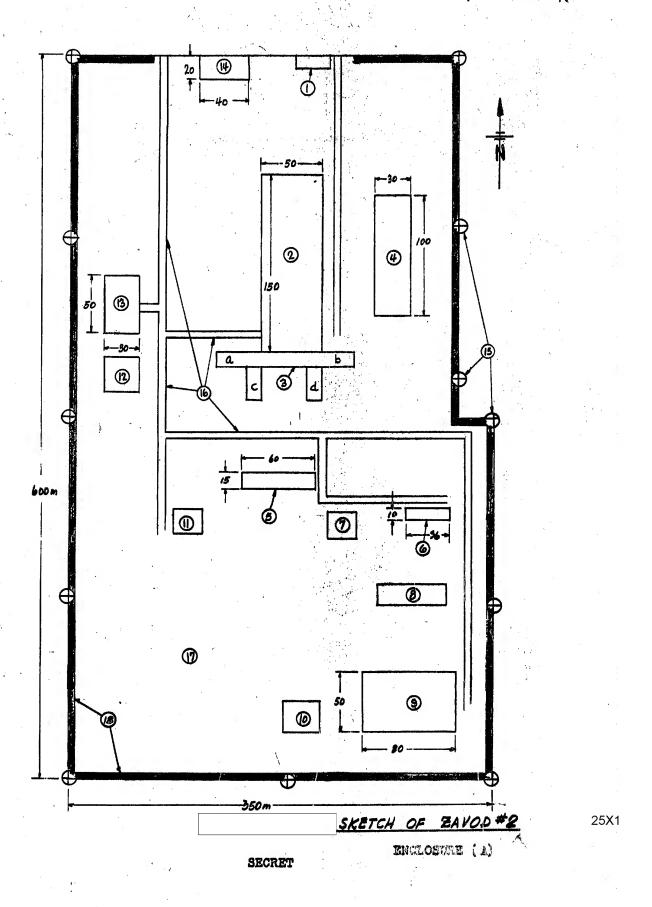

25X1

Approved For Release 2009/08/25 : CIA-RDP81-01028R000100140005-0

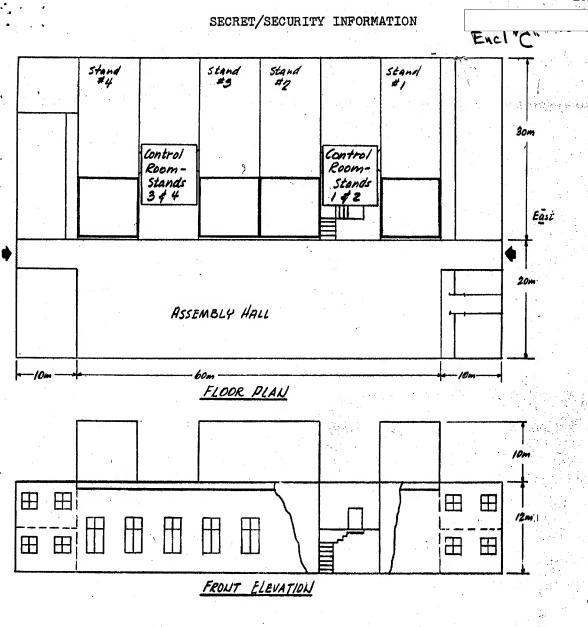

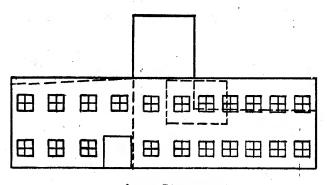

SIDE ELEVATION

NEW TEST STANDS BLDG. #22

ENCLOSURE (c)